



PHOENIX RISING AVIATION, INC.

PO Box 1331 Bartlesville, OK 74005 Phone: 918-337-0200 Fax: 918-337-0208

**Log Book Entry**

June 1, 2018

Falcon 900EX  
N66FJ  
S/N 066

Aircraft Total Time: 9855.6  
Landings: 5896

Ch. 5

1. Complied with CAMP Code **05-08-00-200-800-01** - 1A Inspector IAW F900EX Chapter 5 dated 03/2018.
2. Complied with CAMP Code **05-08-00-200-800-02** - 2A Inspector IAW F900EX Chapter 5 dated 03/2018.
3. Complied with CAMP Code **05-08-00-200-800-11** - 1A+ Inspector IAW F900EX Chapter 5 dated 03/2018.
4. Complied with CAMP Code **05-08-00-200-800-12** - 2A+ Inspector IAW F900EX Chapter 5 dated 03/2018.
5. Complied with CAMP Code **05-08-00-200-800-14** - 4A+ Inspector IAW F900EX Chapter 5 dated 03/2018.
6. Complied with CAMP Code **05-08-00-200-800-18** - ZA Inspector IAW F900EX Chapter 5 dated 03/2018.
7. Complied with CAMP Code **05-08-00-200-800-31** - 1C Inspector IAW F900EX Chapter 5 dated 03/2018.
8. Complied with CAMP Code **05-08-00-200-800-33** - 3C Inspector IAW F900EX Chapter 5 dated 03/2018.
9. Complied with CAMP Code **05-60-00-200-801-01** - Basic Inspection IAW F900EX Chapter 5-60 dated 03/2018.
10. Complied with CAMP Code **05-60-00-200-801-03** - Basic Servicing Operations IAW F900EX Chapter 5-60 dated 03/2018.

Ch. 08 Leveling and Weighing

11. Complied with CAMP Code 08-10-00-910-801 - Aircraft Weighed by Felkins Aircraft Servicies. See Aircraft Loading Manual for Current Weighing Data Sheet dated 05/31/2018.

Ch. 21 Air Conditioning

12. Complied with CAMP Code **21-71-01-350-801-01** - Restoration Left Ozone Converter (Functional Test and Cleaning). P/N D20425-1, S/N 0140. Work Performed IAW F900EX AMM 21-71-01-350-801, Rev. 35 dated 03/2018.
13. Complied with CAMP Code **21-71-01-350-801-02** - Restoration Right Ozone Converter (Functional Test and Cleaning). P/N D20425-1, S/N 0258. Work Performed IAW F900EX AMM 21-71-01-350-801, Rev. 35 dated 03/2018.

Ch. 24 Electrical Power

14. Complied with CAMP Code **24-32-01-350-801-01** - Restoration No. 1 Main Battery (Overhaul) IAW F900EX AMM 24-32-01-350-801, Rev. 35 dated 03/2018.
15. Complied with CAMP Code **24-32-01-350-801-02** - Restoration No. 2 Main Battery (Overhaul) IAW F900EX AMM 24-32-01-700-801, Rev. 35 dated 03/2018.
16. Complied with CAMP Code **24-32-01-700-801-01** - Regular Check of the No. 1 Main Battery IAW F900EX AMM 24-32-01-700-801, Rev. 35 dated 03/2018.
17. Complied with CAMP Code **24-32-01-700-801-02** - Regular Check of the No. 2 Main Battery IAW F900EX AMM 24-32-01-700-801, Rev. 35 dated 03/2018.
18. Complied with CAMP Code **24-32-09-610-801-01** - Service Stand-By Horizon Battery IAW F900EX AMM 24-32-09-610-801, Rev. 35 dated 03/2018.
19. Complied with CAMP Code **24-32-09-610-801-03** - Service No. 2 IRS Stand-By Battery (Securaplane XL245 Type Battery) IAW F900EX AMM 24-32-09-710-802, Rev. 35 dated 03/2018.
20. Complied with CAMP Code **24-32-09-710-802-01** - Perform Operational Test of the Stand-By Horizon Battery IAW F900EX AMM 24-32-09-710-802, Rev. 35 dated 03/2018.

21. Complied with CAMP Code **24-32-09-710-802-02** - Operational Test No. 1 IRS Stand-By Battery (Securaplane XL245 Type Battery) IAW F900EX AMM 24-32-09-710-802, Rev. 35 dated 03/2018.
22. Complied with CAMP Code **24-32-09-710-802-05** - Operational Test No. 3 IRS Stand-By Battery (Securaplane XL245 Type Battery) IAW F900EX AMM 24-32-09-710-802, Rev. 35 dated 03/2018.
23. Comply with CAMP Code **243A85** - Functional Test Communications Stand-By Battery (Securaplane Battery Only).

#### **Ch. 25 Equipment/Furnishing**

24. Complied with CAMP Code **25-61-00-200-881-01** - Inspection of the Emergency Locator Transmitter IAW F900EX AMM 25-61-00-200-881, Rev. 35 dated 03/2018. Battery Expires 04/2021.
25. Complied with CAMP Code **25-61-00-710-801-02** - Operational Test of the Emergency Locator System - Check of ELT Cockpit Controls IAW F900EX AMM 25-61-00-710-801, Rev. 35 dated 03/2018.
26. Complied with CAMP Code **25-61-00-710-801-03** - Perform the Operational Self-Test of the Emergency Locator System. (ELT self-test) IAW F900EX AMM 25-61-00-710-801, Rev. 35 dated 03/2018.
27. Complied with CAMP Code **25-61-13-960-801-01** - Discard ELT Battery Pack IAW F900EX AMM 25-61-13-960-801, Rev. 35 dated 03/2018. Battery Expiration Date: 04/2021.
28. Complied with CAMP Code **25-64-17-350-803-02** - Restoration No. 2 Passenger Life Vest IAW F900EX AMM 25-64-17-350-803, Rev. 35 dated 02/2018. P/N 63600-105, S/N L1030221.
29. Complied with CAMP Code **25-64-17-350-803-03** - Restoration No. 3 Passenger Life Vest IAW F900EX AMM 25-64-17-350-803, Rev. 35 dated 02/2018. P/N 63600-105, S/N L1030228.
30. Complied with CAMP Code **25-64-17-350-803-04** - Restoration No. 4 Passenger Life Vest IAW F900EX AMM 25-64-17-350-803, Rev. 35 dated 02/2018. P/N 63600-105, S/N L1030225.
31. Complied with CAMP Code **25-64-17-350-803-06** - Restoration No. 6 Passenger Life Vest IAW F900EX AMM 25-64-17-350-803, Rev. 35 dated 02/2018. P/N 63600-105, S/N L1030224.
32. Complied with CAMP Code **25-64-17-350-803-07** - Restoration No. 7 Passenger Life Vest IAW F900EX AMM 25-64-17-350-803, Rev. 35 dated 02/2018. P/N 63600-105, S/N L1030222.
33. Complied with CAMP Code **25-64-17-350-803-08** - Restoration No. 8 Passenger Life Vest IAW F900EX AMM 25-64-17-350-803, Rev. 35 dated 02/2018. P/N 63600-105, S/N L103020.
34. Complied with CAMP Code **25-64-17-350-803-09** - Restoration No. 9 Passenger Life Vest IAW F900EX AMM 25-64-17-350-803, Rev. 35 dated 02/2018. P/N 63600-105, S/N L1030226.
35. Complied with CAMP Code **25-64-17-350-803-11** - Restoration No. 11 Passenger Life Vest IAW F900EX AMM 25-64-17-350-803, Rev. 35 dated 02/2018. P/N 63600-105, S/N L1030214.
36. Complied with CAMP Code **25-90-51-350-801-01S** - Restoration of the DME EF-2C Rechargeable Flashslighs (Overhaul) - Flash Light (2LT).
37. Complied with CAMP Code **25-90-51-350-801-02S** - Restoration of the DME EF-2C Rechargeable Flashslighs (Overhaul) - Flash Light (3LT).
38. Protective Breathing Equipment (PBE) is Expired. Installed Serviceable PBE PN 10008180, SN E15020446 and PN 10008180, SN E15020439.

#### **Ch. 26 Fire Protection**

39. Complied with CAMP Code **26-20-09-220-801-01** - Weight Check 504WB APU, Baggage Compartment Fire Extinguisher. Weight: 6 lb 15.3oz. Next Due 05/2019. Work Performed IAW F900EX AMM 26-20-09-220-801, Rev. 35 dated 03/2018.
40. Complied with CAMP Code **26-20-09-220-801-02** - Weight Check 505WB Engine 1 First Shoot, Engine 2 Second Shoot Fire Extinguisher. Weight: 7lb .2oz. Next Due: 05/2019. Work Performed IAW F900EX AMM 26-20-09-220-801, Rev. 35 dated 03/2018.

41. Complied with CAMP Code **26-20-09-220-801-03** - Weight Check 506WB Engine 2 First Shoot, Engine 1 Second Shoot Fire Extinguisher. Weight: 6lb 14oz. Next Due: 05/2019. Work Performed IAW F900EX AMM 26-20-09-220-801, Rev. 35 dated 03/2018.
42. Complied with CAMP Code **26-20-09-220-801-04** - Weight Check 508WB Engine 3 First Shoot, Engine 2 Second Shoot Fire Extinguisher. Weight: 6lb 13.9oz. Next Due: 05/2019. Work Performed IAW F900EX AMM 26-20-09-220-801, Rev. 35 dated 03/2018.
43. Complied with CAMP Code **26-20-09-220-801-05** - Weight Check 507WB Engine 2 First Shoot, Engine 3 Second Shoot Fire Extinguisher. Weight: 6lb 7.4oz. Next Due: 05/2019. Work Performed IAW F900EX AMM 26-20-09-220-801, Rev. 35 dated 03/2018.
44. Complied with CAMP Code **26-20-09-220-801-06** - Weight Check 503WB Mechanic's Servicing Compartment Fire Extinguisher. Bottle weighed at 6lb 12.9oz. Next Due: 05/2019. Work Performed IAW F900EX AMM 26-20-09-220-801, Rev. 35 dated 03/2018.

#### **Ch. 27 Flight Controls**

45. Complied with CAMP Code **27-40-01-210-802-01** - Perform 6 Year/3750 Landing Visual Inspection of the Horizontal Stabilizer Actuator IAW F900EX AMM 27-40-01-900-801 Rev. 35 Dated 03/2018.
46. Left Hand Aileron Center Mounting Bolt is Corroded. Installed New Bolt IAW F900EX AMM 57-60-01-900-801, Rev. 35 dated 03/2018.
47. Left Hand Aileron Center Mounting Bolt Retaining Clip is Damaged. Install New Clip IAW F900EX SRM 51-40-04, Rev. 35 dated 03/2018.
48. Left Hand Aileron Center Mounting Bolt Nut Retainer is Bent/Broken. Installed New Retainer IAW F900EX SRM 51-40-04, Rev. 35 dated 03/2018.
49. Left Aileron Center Mounting Bushing, Outboard under Bolt Retainer is Damaged. Installed New Bushing IAW F900EX SRM 51-71-05, Rev. 35 dated 03/2018.
50. Left Hand Aileron Inboard and Outboard Hinge Bolts are Corroded. Installed New Bolts IAW F900EX AMM 57-60-01-900-801, Rev. 35 dated 03/2018.
51. Left Hand Aileron Bearings Corroded due to paint stripper. Installed New Bearings IAW F900EX AMM 20-45-00-960-802, Rev. 35 dated 03/2018.
52. Left Aileron Servo to Aileron Pivot Bearings Corroded due to paint stripper. Installed New Bearings IAW F900EX AMM 20-45-00-960-802, Rev. 35 dated 03/2018.
53. Left Aileron Inboard and Outboard Hinge Bearings Corroded due to paint stripper. Installed New Bearings IAW F900EX AMM 20-45-00-960-802, Rev. 35 dated 03/2018.
54. Right Hand Aileron Center Mounting Bolt is Corroded. Installed New Bolt IAW F900EX AMM 57-60-01-900-801, Rev. 35 dated 03/2018.
55. Right Hand Aileron Inboard and Outboard Hinge Bolts are Corroded. Installed New Bolts IAW F900EX AMM 57-60-01-900-801, Rev. 35 dated 03/2018.
56. Right Hand Aileron Bearings Corroded due to paint stripper. Installed New Bearings IAW F900EX AMM 20-45-00-960-802, Rev. 35 dated 03/2018.
57. Right Aileron Servo to Aileron Pivot Bearings Corroded due to paint stripper. Installed New Bearings IAW F900EX AMM 20-45-00-960-802, Rev. 35 dated 03/2018.
58. Right Aileron Inboard and Outboard Hinge Bearings Corroded due to paint stripper. Installed New Bearings IAW F900EX AMM 20-45-00-960-802, Rev. 35 dated 03/2018.
59. Left Hand Inboard Flap, Inboard Roller is Dry and has Excessive Linear Play. Installed New Roller IAW F900EX AMM 57-55-13-900-801, Rev. 35 dated 03/2018.
60. Left Hand Outboard Flap, Inboard and Outboard Rollers are Dry and has Excessive Linear Play. Installed New Rollers IAW F900EX AMM 57-55-13-900-801, Rev. 35 dated 03/2018.
61. Right Hand Inboard Flap, Inboard and Outboard Rollers are Dry and has Excessive Linear Play. Installed New Roller IAW F900EX AMM 57-55-13-900-801, Rev. 35 dated 03/2018.
62. Right Hand Outboard Flap, Middle Roller Bearings are Dry and have Excessive Play. Installed New Bearings IAW F900EX AMM 57-60-05-640-801, Rev. 35 dated 03/2018.
63. Right Hand Inboard Flap Lower Spring Support Broken. Installed New Spring Support on Right Hand Inbd Flap IAW F900EX AMM 57-55-07-900-801, Rev. 35 dated 03/2018.

#### **Ch. 28 Fuel**

64. Complied with CAMP Code **28-21-14-720-801-01** - Functional Test BP1 Manifold Thermal Expansion Systems IAW F900EX AMM 28-21-05-900-801, Rev. 35 dated 03/2018.
65. Complied with CAMP Code **28-21-14-720-801-02** - Functional Test BP2 Manifold Thermal Expansion Systems IAW F900EX AMM 28-21-50-900-801, Rev. 35 dated 03/2018.
66. Complied with CAMP Code **28-21-14-720-801-03** - Functional Test BP3 Manifold Thermal Expansion Systems IAW F900EX AMM 28-21-05-900-801, Rev. 35 dated 03/2018.

67. Complied with CAMP Code **28-30-00-680-802-05** - Draining of the Fuel Tanks Sumps IAW F900EX AMM 28-30-00-680-802, Rev. 35 dated 03/2018.
68. Complied with CAMP Code **28-30-00-680-802-06** - Draining of the Fuel Tanks / Fuel Sampling - Leak Check of the Dry Bay IAW F900EX 28-30-00-680-802, Rev. 35 dated 03/2018.
69. Complied with CAMP Code **28-30-00-680-803-01** - Draining of the Gravity Defueling Line IAW F900EX AMM 28-30-00-680-803, Rev. 35 dated 03/2018.
70. Complied with CAMP Code **28-70-09-350-801-01** - Restoration Right Pressurization Valve Box (Filter Cleaning and Calibration) IAW F900EX AMM 28-70-09-350-801, Rev. 35 dated 03/2018.
71. Comply with CAMP Code **28-70-09-350-801-02** - Restoration Right Pressurization Valve Box (Filter Cleaning and Calibration) IAW F900EX AMM 28-70-09-350-801, Rev. 35 dated

#### **Ch. 29 Hydraulics**

72. Complied with CAMP Code **29-20-03-220-801-01** - Check Stand-By Electric Pump Motor IAW F900EX AMM 29-20-03-220-801, Rev. 35 dated 03/2018.
73. Complied with CAMP Code **29-20-03-720-801-01** - Functional Test Stand-By Electric Pump Motor IAW F900EX AMM 29-20-03-720-801, Rev. 35 dated 03/2018.

#### **Ch. 30 Ice & Rain Protection**

74. Complied with CAMP Code **30-20-01-700-801-01** - Functional/Sealing Test No. 1 Engine Air Intake Anti-Icing Pressure Regulating Valve IAW F900EX AMM 30-20-01-720-801, Rev. 35 dated 03/2018.
75. Complied with CAMP Code **30-20-01-700-801-03** - Functional/Sealing Test No. 3 Engine Air Intake Anti-Icing Pressure Regulating Valve IAW F900EX AMM 30-20-01-720-801, Rev. 35 dated 03/2018.

#### **Ch. 31 Indicating & Recording**

76. Complied with CAMP Code **31-21-05-960-801-01** - Replacement of the Pilot Clock Battery IAW F900EX AMM 31-21-05-960-801, Rev. 35 dated 03/2018.
77. Complied with CAMP Code **31-21-05-960-801-02** - Replacement of the Co-Pilot Clock Battery IAW F900EX AMM 31-21-05-960-801, Rev. 35 dated 03/2018.
78. Replaced Aft Maintenance Panel Due to #2 Engine Chip Detector Indicator Failure. P/N Off: FGFB600912110A5, S/N Off: 868. P/N On: FGFB600912110A5, S/N On: 850.

#### **Ch. 32 Landing Gear**

79. Complied with CAMP Code **32-11-00-220-801-01** - Perform Detailed Inspection of the LMLG Leg. No Defects Noted. Work Performed IAW F900EX AMM 32-21-00-220-801, Rev. 35 dated 03/2018.
80. Complied with CAMP Code **32-11-00-220-801-02** - Perform Detailed Inspection of the RMLG Leg. No Defects Noted. Work Performed IAW F900EX AMM 32-21-00-220-801, Rev. 35 dated 03/2018.
81. Complied with CAMP Code **32-21-00-220-801-01** - Perform Detailed Inspection of the NLG Leg. No Defects Noted. Work Performed IAW F900EX AMM 32-21-00-220-801, Rev. 35 dated 03/2018.
82. Complied with CAMP Code **32-44-00-220-801-01** - Detailed Inspection of the Left Hand Main Landing Gear Outboard Tire IAW F900EX AMM 32-44-00-220-801, Rev. 35 dated 03/2018.
83. Complied with CAMP Code **32-44-00-220-801-02** - Detailed Inspection of the Left Hand Main Landing Gear Inboard Tire IAW F900EX AMM 32-44-00-220-801, Rev. 35 dated 03/2018.
84. Complied with CAMP Code **32-44-00-220-801-03** - Detailed Inspection of the Right Hand Main Landing Gear Inboard Tire IAW F900EX AMM 32-44-00-220-801, Rev. 35 dated 03/2018.
85. Complied with CAMP Code **32-44-00-220-801-04** - Detailed Inspection of the Right Hand Main Landing Gear Outboard Tire IAW F900EX AMM 32-44-00-220-801, Rev. 35 dated 03/2018.
86. Complied with CAMP Code **32-44-00-220-801-05** - Detailed Inspection of the LH Nose Tire IAW F900EX AMM 32-44-00-220-801, Rev. 35 dated 03/2018.
87. Complied with CAMP Code **32-44-00-220-801-06** - Detailed Inspection of the RH Nose Tire IAW F900EX AMM 32-44-00-220-801, Rev. 35 dated 03/2018.
88. Complied with CAMP Code **32-44-00-780-801-01** - Pressure Check LH Main Landing Gear Outboard Tire Pressure IAW F900EX AMM 32-44-00-780-801, Rev. 35 dated 03/2018.
89. Complied with CAMP Code **32-44-00-780-801-02** - Pressure Check LH Main Landing Gear Inboard Tire Pressure IAW F900EX AMM 32-44-00-780-801, Rev. 35 dated 03/2018.

90. Complied with CAMP Code **32-44-00-780-801-03** - Pressure Check RH Main Landing Gear Inboard Tire Pressure IAW F900EX AMM 32-44-00-780-801, Rev. 35 dated 03/2018.
91. Complied with CAMP Code **32-44-00-780-801-04** - Pressure Check RH Main Landing Gear Outboard Tire Pressure IAW F900EX AMM 32-44-00-780-801, Rev. 35 dated 03/2018.
92. Complied with CAMP Code **32-44-00-780-801-05** - Pressure Check LH Nose Landing Gear Tire Pressure IAW F900EX AMM 32-44-00-780-801, Rev. 35 dated 03/2018.
93. Complied with CAMP Code **32-44-00-780-801-06** - Pressure Check RH Nose Landing Gear Tire Pressure IAW F900EX AMM 32-44-00-780-801, Rev. 35 dated 03/2018.
94. Left and Right Nose Landing Gear Bearing Assemblies corroded. Installed 2 New Bearing Assemblies IAW F900EX AMM 32-21-00-900-801, Rev. 35 dated 03/2018.
95. Installed New Nose Tires per Customers Request. NDT Performed on wheel halves by Tailwind Inspection, Inc. Installed New Tires. Work Performed IAW F900 AMM 32-44-05-900-801, Rev. 35 dated 03/2018.
96. L/H MLG Uplock Functional Test Out of Limits. Installed Repaired MLG uplock. Performed Gear Functional Test. No defect noted. Work Performed IAW F900EX AMM 32-12-17-900-801, Rev. 35 dated 03/2018.

### Ch. 33 Lights

97. Complied with CAMP Code **33-50-00-720-801-01** - Functional Test No. 1 Emergency Lighting (EPS1) Power Supply System IAW F900EX AMM 33-50-00-720-801, Rev. 35 dated 03/2018.
98. Complied with CAMP Code **33-50-00-720-801-02** - Functional Test No. 2 Emergency Lighting (EPS2) Power Supply System IAW F900EX AMM 33-50-00-720-801, Rev. 35 dated 03/2018.
99. Complied with CAMP Code **33-50-37-960-802-01** - Discard #1 EPS P/N D734-02-001 S/N-2993 with New P/N- D734-02-001 S/N- 3819144. Work Performed IAW F900EX AMM 33-50-37-960-802, Rev. 35 dated 03/2018.
100. Complied with CAMP Code **33-50-37-960-802-02** - Discard #2 EPS P/N- D734-02-001 S/N-3150 with new P/N- D734-02-001 S/N- 3819145. Work Performed IAW F900EX AMM 33-50-37-960-802, Rev. 35 dated 03/2018.
101. Complied with CAMP Code **33-50-37-960-802-03** - Discard of #3 EPS Pack Battery Pack IAW F900EX AMM 33-50-37-960-802, Rev. 35 dated 03/2018. Installed P/N D734-02-001, S/N 3819145.

### Ch. 34 Navigation

102. Complied with CAMP Code **34-58-01-710-881-01** (FAR 91.171) - Perform the 30 Day Check of Equipment for IFR Operation in accordance with FAR 91.171.
103. Complied with Dassault Service Bulletin S002. Installed Honeywell GLSSU, P/N HG2021KB02 (X2), S/N's 3333 and 3316. Installed WAAS/GPS Antennas (X2), P/N S67-1575-137, S/N's 773-5155 and 773-5158.
104. Installed provisions for ADS-B DO-260B compliant transponders.
105. Performed TCAS 7.1 Upgrade IAW STC ST00881WI. Removed TCAS Processor TTR-920, P/N 622-8971-122, S/N 7972 and Installed TCAS Processor TTR-921, P/N 822-1293-002 S/N147491.
106. Replaced IAC 810 Internal batteries with new in accordance with Honeywell Service Bulletin 7017300-22-10 Rev 1. Jul 2013 Battery Expiration date: May 2019.

### Ch. 35 Oxygen

107. Comply with CAMP Code **35-10-05-350-801-03** - Restoration Third Crew Member Oxygen Mask (Overhaul).
108. Comply with CAMP Code **35-10-05-710-801-01** - Operational Test of the Crew Oxygen Masks - LH Pilot Oxygen Mask (L502WH).
109. Comply with CAMP Code **35-10-05-710-801-02** - Operational Test of the Crew Oxygen Masks - RH Pilot Oxygen Mask (R502WH).

### Ch. 49 APU

110. Complied with CAMP Code **494030** - APU - Inspect/Clean Ignitor Plug.
111. Complied with CAMP Code **499020** - APU - Remove and Inspect Magnetic Drain Plug.
112. Complied with CAMP Code **499030** - APU - Drain and Refill Oil.
113. Complied with CAMP Code **499040** - APU Remove and Replace Oil Filter Element.
114. Ignitor Plug Worn Beyond Limits. Installed New APU Ignitor.

### Ch. 52 Doors

115. Complied with Task Codes **52-20-00-610-801-01A** - Servicing of the Emergency Exit Door - Test of the Emergency Exit Door Unlocking From Inside the Cabin IAW F900EX AMM 52-20-00-610-801, Rev. 35 dated 03/2018.
116. Replaced both MED Telescoping Rods and Adjusted IAW F900EX AMM 52-10-00-820-801, Rev. 35 dated 03/2018.

### Ch. 53 Fuselage

117. Complied with CAMP Code **53-00-00-210-801-01C** - General Inspection of Fuselage IAW F900EX AMM 53-00-00-210-801-01, Rev. 35 dated 03/2018.
118. Complied with CAMP Code **53-00-00-220-801-01C** Detailed Inspection of Fuselage IAW F900EX AMM 53-00-00-220-801-01, Rev. 35 dated 03/2018.
119. Complied with CAMP Code **53-10-00-220-802-01C** - Detailed Inspection of the Flight Compartment IAW F900EX AMM 53-10-00-220-802-01, Rev 35 dated 03/2018.
120. Complied with CAMP Code **53-10-00-200-808-01C** - Inspection of the Nose Landing Gear bay IAW F900 EX AMM 53-10-00-200-808, Rev. 35 dated 03/2018.
121. Complied with CAMP Code **53-10-03-220-801-03C** - Detailed Inspection of the Passenger Door Frame Under the Upper and Lower Edging Strips. Removed MED for Inspection. Found Corrosion under Lower Edging Strip. Repaired MED Lower Threshold IAW Dassault Aviation CAS Sheet R6595 dated 03/14/2018 and Dassault Aviation Drawing F2MA222105A6. Re-Installed MED and Performed Functional Test.
122. Complied with CAMP Code **53-10-39-220-801-01C** - Inspection of the Lower Section of the Cockpit Windshield and Window Frames IAW F900EX AMM 53-10-39-220-801-01, Rev. 35 dated 03/2018.
123. Complied with CAMP Code **53-10-39-220-802-01C** - Detailed Inspection of the Cockpit Windshield / Window Frames. No Defects Noted. Work Performed IAW F900EX AMM 53-10-39-330-802, Rev. 35 dated 03/2018.
124. Complied with CAMP Code **53-11-00-210-801-01C** - General Inspection of Nose Cone Area IAW F900EX AMM 53-11-00-210-801-01, Rev 35, Dated 03/2018.
125. Complied with CAMP Code **53-30-00-220-801-01C** - Detailed Inspection of the Passenger Cabin IAW F900EX AMM 53-30-00-220-801-01, Rev. 35 dated 03/2018.
126. Complied with CAMP Code **53-40-00-200-804-01C** - Inspection of the L/H Main Landing Gear Bay IAW F900EX AMM 53-40-00-200-804, Rev. 35 dated 03/2018.
127. Complied with CAMP Code **53-40-00-200-804-02C** - Inspection of the R/H Main Landing Gear Bay IAW F900EX AMM 53-40-00-200-804, Rev. 35 dated 03/2018.
128. Complied with CAMP Code **53-40-00-210-802-01C** - General Visual Inspection of Lower Fuselage IAW F900EX AMM 53-40-00-210-802-01, Rev. 35, Dated 03/2018.
129. Complied with CAMP Code **53-40-00-220-802-01C** - Detailed Inspection of the Fuselage Structural Fuel Tanks IAW F900EX AMM 53-40-00-220-802, Rev. 35 dated 03/2018.
130. Complied with CAMP Code **53-41-00-220-801-01C** - Detailed Inspection of the L/H Upper Wing Root Bolts Recesses IAW F900EX AMM 53-41-00-220-801 Rev. 35 dated 03/2018.
131. Complied with CAMP Code **53-41-00-220-801-02C** - Detailed Inspection of the R/H Upper Wing Root Bolts Recesses IAW F900EX AMM 53-41-00-220-801, Rev. 35 dated 03/2018.
132. Complied with CAMP Code **53-41-00-620-802-01C** - Renewal of the Temporary Protection of the Upper LH Wing Root Bolt Recesses IAW F900EX AMM 53-41-00-620-802, Rev. 35 dated 03/2018.
133. Complied with CAMP Code **53-41-00-620-802-02C** - Renewal of the Temporary Protection of the Upper RH Wing Root Bolt Recesses IAW F900EX AMM 53-41-00-620-802, Rev. 35 dated 03/2018.
134. Complied with CAMP Code **53-50-00-210-804-01C** - General Visual Inspection of the Rear Compartment IAW F900EX AMM 53-50-00-220-804, Rev. 35 dated 03/2018.
135. Complied with CAMP Code **53-50-00-210-806-01C** - General Visual Inspection of the Baggage Compartment IAW F900EX AMM 53-50-00-210-806, Rev. 35 dated 03/2018.
136. Complied with CAMP Code **53-50-00-220-803-01C** - Detailed Inspection of the Baggage Compartment IAW F900EX AMM 53-50-00-220-803-01C, Rev. 35 dated 03/2018.
137. Complied with CAMP Code **53-50-00-220-805-01C** - Detailed Inspection of the Rear Compartment IAW F900EX AMM 53-50-00-220-805, Rev. 35 dated 03/2018.

#### Ch. 54 Nacelles/Pylons

138. Repaired S-Duct Double Skin IAW Dassault Aviation CDS Sheet R6664 dated 03/16/2018 and Dassault Aviation Drawing FGFB258702A8.

#### Ch. 55 Stabilizers

139. Complied with CAMP Code **55-00-00-210-801-01C** - General Visual Inspection of the Horizontal and Vertical Stabilizers and the No. 2 engine air intake and S-duct IAW F900EX AMM 55-00-00-210-801, Rev. 35 dated 02/2018.
140. Complied with CAMP Code **55-00-00-220-801-01C** - Detailed Inspection of the Horizontal and Vertical Stabilizers and the No. 2 engine air intake and S-duct IAW F900EX AMM 55-00-00-220-801-01, Rev. 35 dated 02/2018.
141. Both L/H Elevator Attach Bolts are Scored. Installed New L/H Elevator Attach Bolts IAW F900EX AMM 55-20-01-900-801, Rev. 35 dated 03/2018.
142. Both R/H Elevator Attach Bolts are Scored. Installed New R/H Elevator Attach Bolts IAW F900EX AMM 55-20-01-900-801, Rev. 35 dated 03/2018.
143. L/H Elevator Gimble Bolts are Scored. Installed New L/H Elevator Gimble Bolts IAW F900 AMM 55-20-01-900-801, Rev. 35 dated 03/2018.
144. L/H and R/H Horizontal Aft Hinge Pins Corroded. Installed New Pin Assemblies IAW F900EX AMM 55-10-01-900-801, Rev. 35 dated 03/2018.
145. L/H Elevator Hinge Bearings are Frozen. Installed New Bearing IAW F900EX AMM 20-45-00-960-802, Rev. 35 dated 03/2018.
146. R/H Elevator Hinge Bearings are Frozen. Installed New Bearing IAW F900EX AMM 20-45-00-960-802, Rev. 35 dated 03/2018.

#### Ch. 56 Windows

147. Replaced all Interior False Windows due to cracked mount holes.

#### Ch. 57 Wings

148. Complied with CAMP Code **57-00-00-210-801-01C** - General Visual Inspection of the L/H Wing IAW F900EX AMM 57-00-00-210-801, Rev. 35 dated 03/2018.
149. Complied with CAMP Code **57-00-00-210-801-02C** - General Visual Inspection of the R/H Wing IAW F900EX AMM 57-00-00-210-801, Rev. 35 dated 03/2018.
150. Complied with CAMP Code **57-00-00-220-802-01C** - Detailed Inspection of the L/H Wing IAW F900EX AMM 57-00-00-220-802, Rev. 35 dated 03/2018.
151. Complied with CAMP Code **57-00-00-220-802-02C** - Detailed Inspection of the R/H Wing IAW F900EX AMM 57-00-00-220-802, Rev. 35 dated 03/2018.


#### Ch. 76 Engine Controls

152. #3 Engine Throttle Control Torque Tube Outer Lever is Corroded. Installed New Lever and Rigged Throttle Cable IAW F900EX AMM 76-10-00-820-802, Rev. 35 dated 03/2018.

#### Airworthiness Directives

153. Complied with **AD 1999-25-09** (Eff. Date 01/12/2000) Paragraph (b). Dimensional Inspection of the Horizontal Stab Aft Hinge Pins. No Defects Noted. Next Due: 13,605.6 or 05/2024 whichever occurs first.
154. Complied with **AD 2008-04-14** (Eff. Date 04/01/2008) Test of R/H Emergency Exit Inside Latching. No Defects Noted. Next Due 05/2020.

I certify that this aircraft (F900EX-066) has been inspected/repaired IAW current Federal Aviation Administration regulations and was determined to be in airworthy condition and is approved for return to service with respect to the work performed. Details of work performed are on file at this agency under Work Order PRA0109-12-2017.

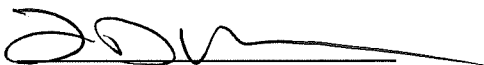

Authorized Signature

**John D. Thompson**

Phoenix Rising Aviation, Inc.

CRS# XVOR782X

06/01/2018